




Montageanleitung / Mounting Instruction




Erweiterungsverschraubungen / Enlarging cable glands

EMSKV **.-** / ESSKV(-4) **.-**

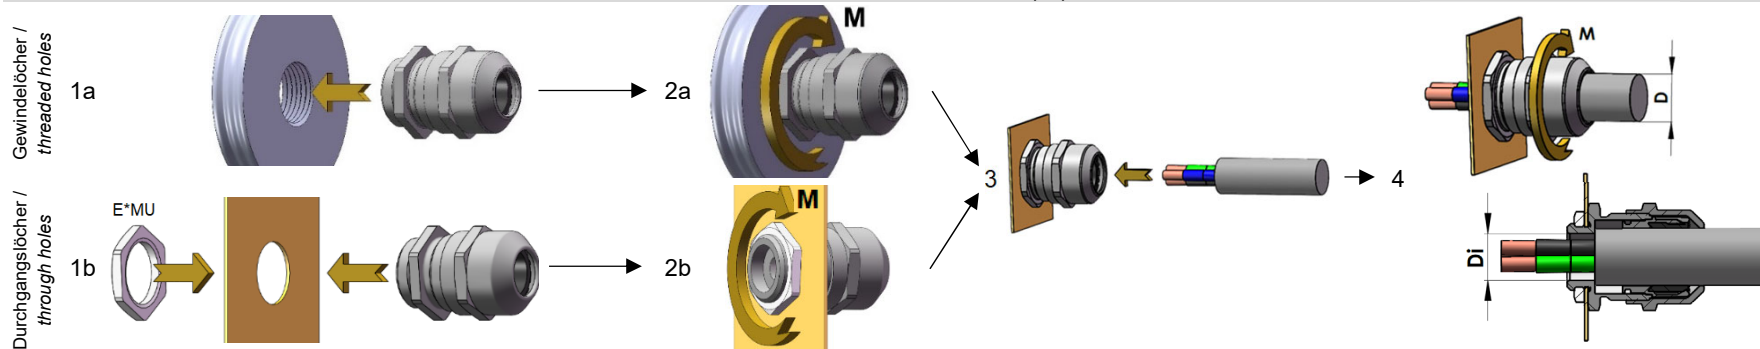

EMSKV **.-** EMV-Z / ESSKV(-4) **.-** EMV-Z

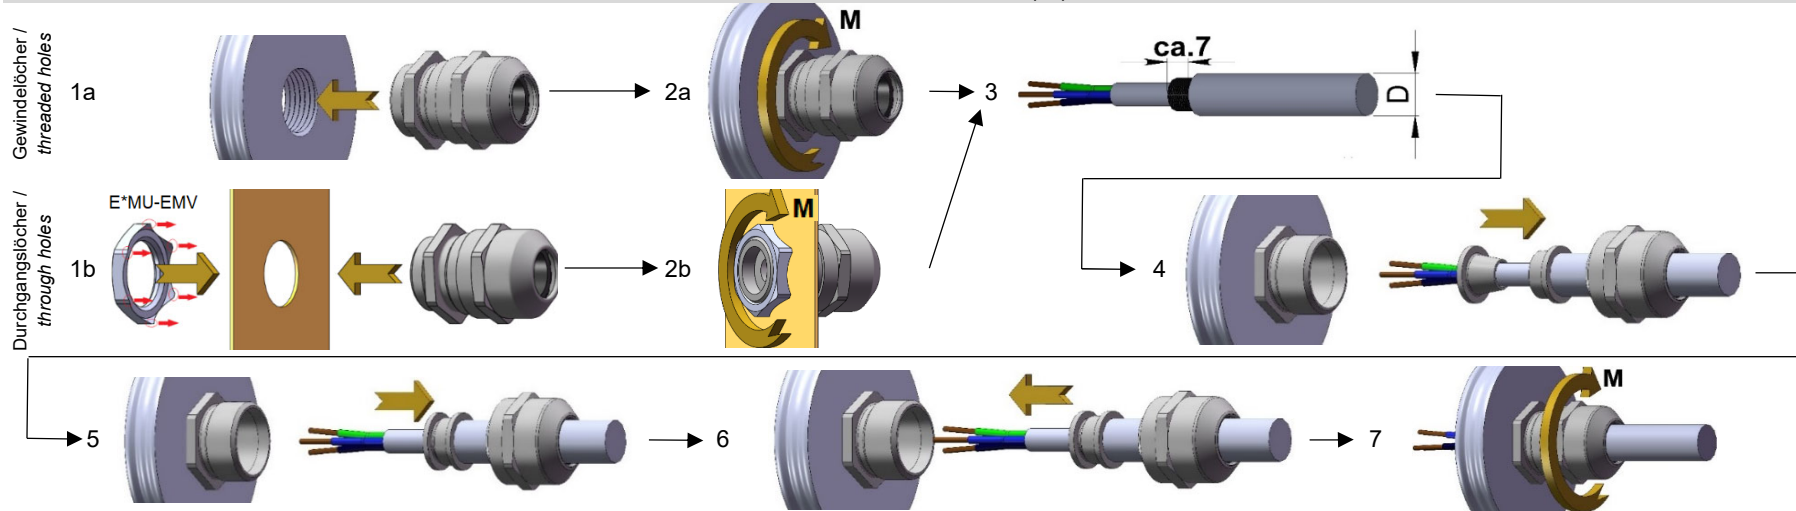

Kabelverschraubung / cable gland	M [Nm] ¹⁾	Di [mm]	D [mm]
E*SKV 12-16 [+ E*MU 12]; E*SKV 12-16 EMV-Z [+ E*MU-EMV 12]	4,0	8	4,5 - 9
E*SKV 16-20 [+ E*MU 16]; E*SKV 16-20 EMV-Z [+ E*MU-EMV 16]	8,0	12	6 - 13
E*SKV 20-25 [+ E*MU 20]; E*SKV 20-25 EMV-Z [+ E*MU-EMV 20]	10,0	14	9 - 17
E*SKV 25-32 [+ E*MU 25]; E*SKV 25-32 EMV-Z [+ E*MU-EMV 25]	20,0	20	13 - 21
E*SKV 32-40 [+ E*MU 32]; E*SKV 32-40 EMV-Z [+ E*MU-EMV 32]	20,0	26	16 - 28
E*SKV 40-50 [+ E*MU 40]; E*SKV 40-50 EMV-Z [+ E*MU-EMV 40]	30,0	35	21 - 35
E*SKV 50-63 [+ E*MU 50]; E*SKV 50-63 EMV-Z [+ E*MU-EMV 50]	40,0	40	34 - 48
E*SKV 63-75 [+ E*MU 63]; E*SKV 63-75 EMV-Z [+ E*MU-EMV 63]	40,0	57	48 - 62



WISKA Hoppmann GmbH • Kisdorfer Weg 28 • 24568 Kaltenkirchen • Germany

¹⁾ Die angegebenen Drehmomente wurden unter Laborbedingungen und mit Prüfdornen nach EN 62444 ermittelt. Damit handelt es sich bei den Drehmomenten um Richtwerte. Die Drehmomente sollten unter Normalklima für Stutzen und Gegenmuttern eingehalten werden. Je nach verwendetem Kabel ist beim Anziehen der Hutmuttern darauf zu achten, dass die Drehmomente nicht überschritten werden um Kabelbeschädigungen zu vermeiden. / The specified torques were determined under laboratory conditions and with test mandrels according to EN 62444. The torques are therefore guide values. The torques should be observed under normal climatic conditions for fittings and locknuts. Depending on the cable used, care must be taken when tightening the cap nuts that the torques are not exceeded in order to avoid cable damage.

(Technische Änderungen vorbehalten. / Technical changes reserved.)

Moln_E#SKV-Erweiterung_2023-08-14